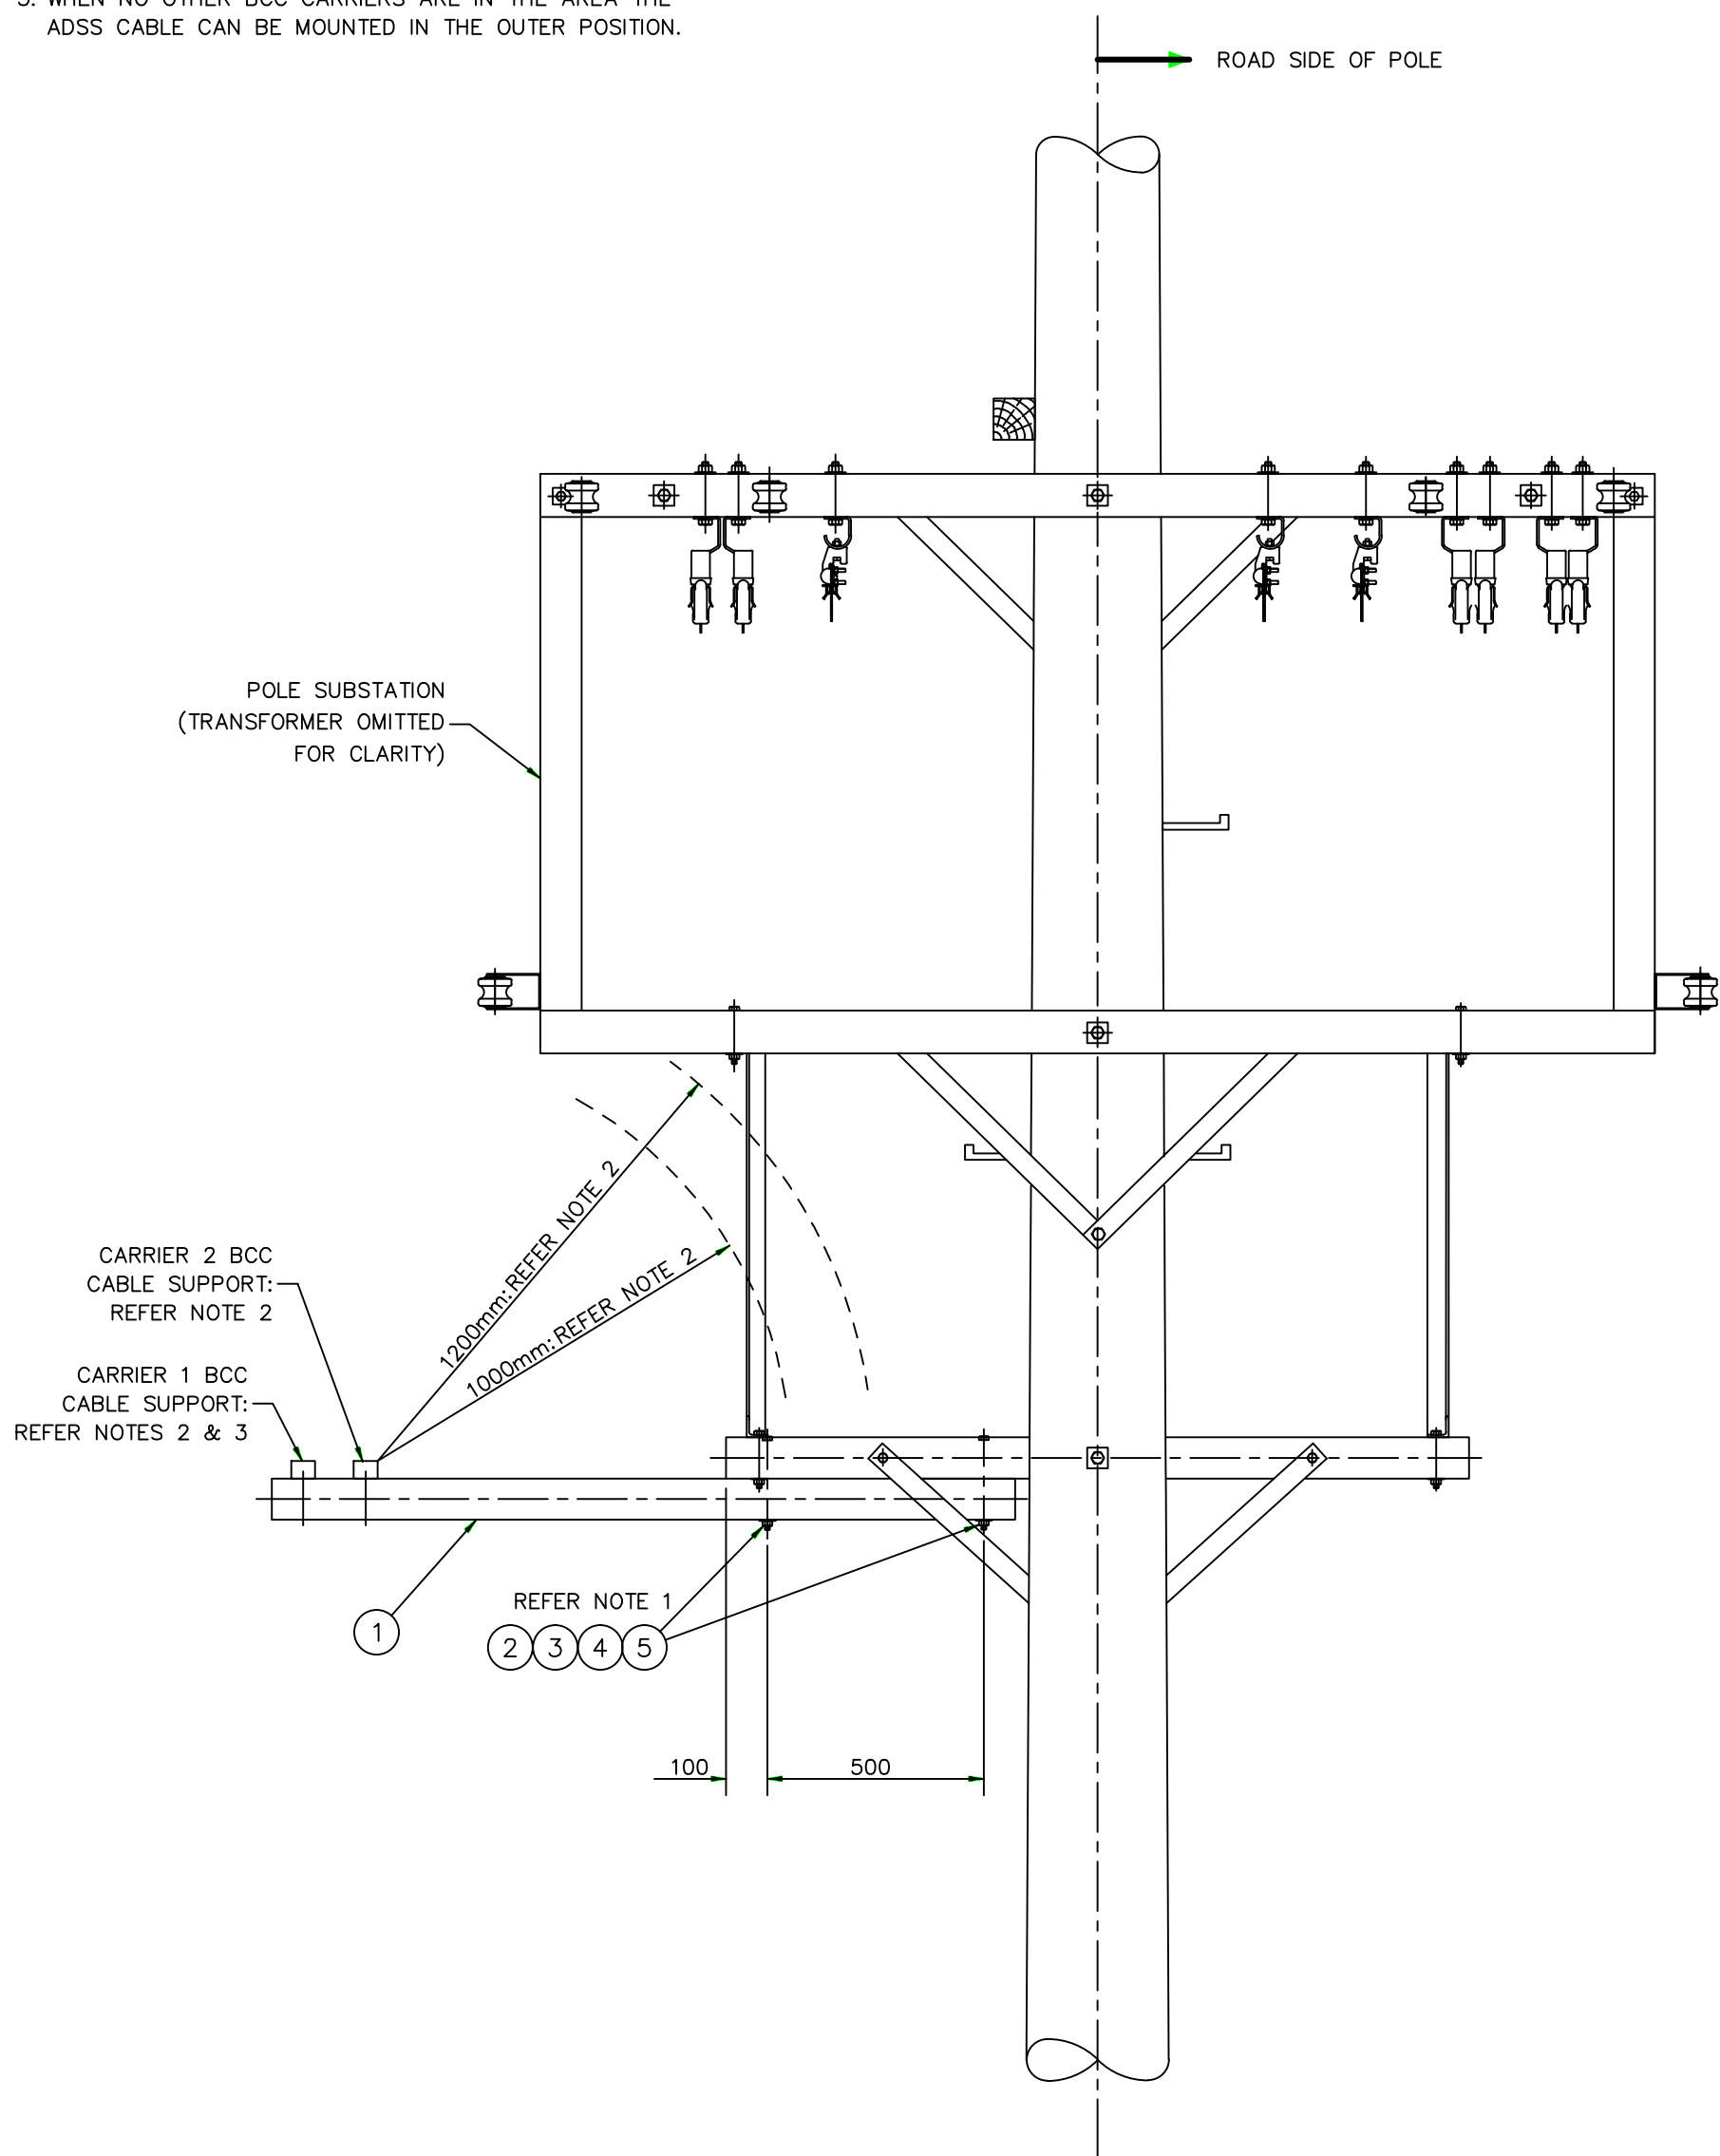




AMENDMENTS		1
A	ORIGINAL ISSUE	
J R No.		930208
B	DR'N	CRT.
	CH'D	CRT.
	DATE	08-2-96
	JR No	930208
BCC WAS BCCC.		
SEO		C.H.P.
C	DR'N	CRT.
	CH'D	CRT.
	DATE	04-3-97
	JR No	960080
BCC CARRIER 2 & NOTE 2 ADDED.		
MPDO		CHP
D	DR'N	R.H.
	CH'D	G.J.B.
	DATE	27-3-01
	JR No	NA
NOTE 3 ADDED.		
DSM		G.J.B.
E	DR'N	J.P.
	CH'D	M.A.S.
	DATE	17-02-14
	JR No	NA
VOCAB DRG REMOVED		
DSM		M.A.S.

NOTES

1. DRILL EXISTING CROSSARM TO COUNTERSINK BOLT HEAD & WASHER.
2. MINIMUM RADIAL SEPARATION FROM BCC CABLES TO HV & LV BUSHINGS ON POLE MOUNTED SUBSTATION TO BE:
LV: 1.0m
HV: 1.2m
3. WHEN NO OTHER BCC CARRIERS ARE IN THE AREA THE ADSS CABLE CAN BE MOUNTED IN THE OUTER POSITION.

ITEM NO	DESCRIPTION	QTY	REFER
1	CROSSARM 100 X 100 X 2100LG	1	—
2	BOLT STEEL HEX HD GALV M16 X 260LG	2	—
3	WASHER STEEL FLAT SQ GALV 16	2	—
4	WASHER S/STEEL COIL SPRING M12 — M16	2	—
5	WASHER STEEL FLAT RND GALV 16	4	—



		© This drawing and the copyright therein is the property of Endeavour Energy and may not be copied, reproduced, distributed, loaned or used without the written consent of Endeavour Energy.		 Endeavour Energy					
 ORIGINAL SCALE NONE		APPROVED C.BROWN				REFERENCE DRAWINGS			
				DO NOT SCALE DIMENSIONS IN MILLIMETRES		AUTHORISED W.Isley			
DRAWN		C.T.				MAINS DEVELOPMENT MANAGER		13-02-96	
DATE		05-5-95				A2P		078618	
CH'D		C.T.						E	
								SHEET No 1 OF 1 SHEETS	